

SERVICE INFORMATION

Pedal track fault

Date: 17-01-2012

Reason of information:

In combination with after market cruise control unit, car ECU will periodically produce a fault message P2138 in the diagnostic message system.

Fault appears:

Limping mode become active. DTC codes are generated.

Reason of fault:

Bad connection between terminals and wire crimps inside the moulding connector (pedal interface) generate too high resistance.

Solution:

Change out the existing main wire with new type part no. DCS-CC-OE-34A.

